



TSB#C1701 F13 ERROR CODE (Modcon Models)

**NOTICE: THE FOLLOWING EXPLAINS/CLARIFIES QUESTIONS REGARDING THE
RANDOM F13 ERROR CODE ON PRODUCTS USING AMETEK FANS!
Follow these instructions to identify.**

⚠ WARNING


Ensure all electrical power to the appliance is turned OFF before continuing with this process. Failure to do so could result in property damage, serious personal injury, or death.

When using Ametek fans like the one shown below, random F13 error codes can occur.



This is caused by minor low stray voltage being picked up by the fan circuit.

A voltage filter (shown below) has been created to correct this. Part # 7350P-800

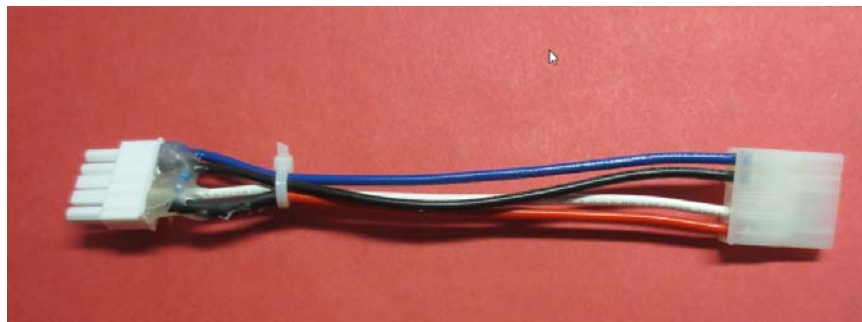

- Turn power off to the unit

- Unplug the four wire Molex connecting to the fan
 - Plug in the voltage filter (7350P-800) to the fan
- Plug the wire harness into the other end of the voltage filter
 - Turn the power back on



NOTE: If F13 Persists after installing the Voltage Filter, replace fan assembly.

All further/future shipments have been checked at the factory
We apologize for any inconvenience.
For Further Assistance, Contact Technical Support at
1-800-323-9651 or techsupport@htproducts.com